


VHM-Schwalbenschwanzfräser, Z=2

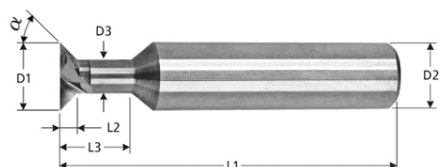

Bestellnummer	Winkel	D1(mm)	D2(mm)	D3(mm)	L1(mm)	L2(mm)	L3(mm)	RG
SW45-3/3-40	45°	3.0	3.0	2.0	40.0	0.5	6.0	1
SW5-3/3-40	5°	3.0	3.0	2.0	40.0	3.0	6.0	1
SW60-3/3-40	60°	3.0	3.0	2.0	40.0	0.29	6.0	1
SW30-3/3-40	30°	3.0	3.0	2.0	40.0	0.87	6.0	1
SW45-4/6-50	45°	4.0	6.0	2.0	50.0	1.0	6.0	1
SW60-4/6-50	60°	4.0	6.0	2.0	50.0	0.58	6.0	1
SW30-4/6-50	30°	4.0	6.0	2.0	50.0	1.73	6.0	1
SW60-5/6-50	60°	5.0	6.0	2.5	50.0	0.72	6.0	1
SW45-5/6-50	45°	5.0	6.0	2.5	50.0	1.25	6.0	1
SW30-5/6-50	30°	5.0	6.0	2.5	50.0	2.17	6.0	1
SW45-6/6-50	45°	6.0	6.0	3.0	50.0	1.5	6.0	1
SW30-6/6-50	30°	6.0	6.0	3.0	50.0	2.6	6.0	1
SW60-6/6-50	60°	6.0	6.0	3.0	50.0	0.87	6.0	1
SW5-6/6-50	5°	6.0	6.0	5.0	50.0	6.0	6.0	1
SW45-8/8-64	45°	8.0	8.0	3.5	64.0	2.25	8.0	1